




Digital Micrometer

Part Number: 52-224 series

[1] Name and Function of Each Part

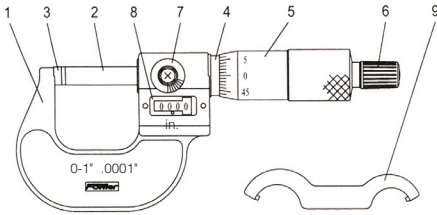

- | | | |
|-----------|------------|-----------------|
| 1. Frame | 2. Spindle | 3. Anvil |
| 4. Sleeve | 5. Thimble | 6. Ratchet stop |
| 7. Clamp | 8. Counter | 9. Wrench |

Safety Precautions

To ensure operator safety, use this instrument in conformance with the directions and specifications given in this User's Manual.




The edge of the contact point of this instrument is sharp. Handle it with great care to avoid injury.

IMPORTANT

- Do not disassemble this instrument.
- Do not use and store this instrument at sites where the temperature will change abruptly. Prior to use, thermally stabilize the instrument sufficiently at a room temperature.
- Avoid storing this instrument in places where there is plenty of moisture and dust, and using it at sites where it is directly subject to water or oil.
- Do not apply excessive force to this instrument or drop it.
- Be sure to perform the zero point adjustment before measurement.
- After use, wipe off dust, cutting chips, and moisture from this instrument, then apply rust-preventive oil to it.

[2] How to Read

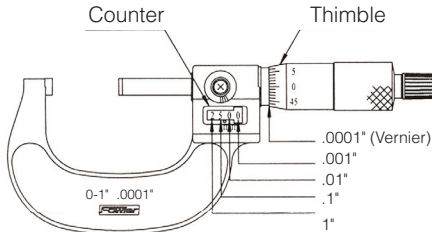

[1] Name and Function of Each Part

See the figure on the left.

[2] How to Read

See the figure on the left.

[3] Zero Point Adjustment

IMPORTANT

- Be sure to use the dedicated gauge block for the zero point adjustment (all of these should be inspected periodically), the standard bar for micrometer, or dedicated master gages for the workpiece to perform the zero point adjustment of this instrument.
- Wipe off the measuring faces of the gage used and this instrument cleanly before performing the zero point adjustment.
- Perform the zero point adjustment in the same posture and conditions as the measurement.

[3] Zero Point Adjustment

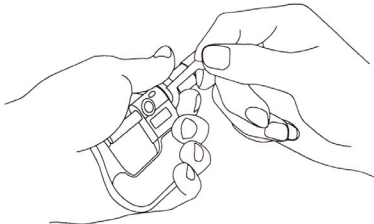


Fig.1

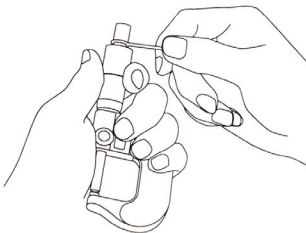


Fig.2

1) When the reading is correct on the counter and wrong on the thimble

(1) If the deviation is less than 0.02mm:

Rotate the sleeve with the supplied wrench by the observed error as in the case for conventional micrometers. (Fig. 1)

(2) If the deviation is over 0.02mm:

Remove the ratchet stop with the supplied wrench. Push the thimble outward to disengage it from the spindle, then rotate it to zero position. (Fig. 2)




PLASTIC PROCESS EQUIPMENT, INC.

8303 Corporate Park Drive, Macedonia, Ohio 44056

216-367-7000 • 800-362-0706 • Fax: 216-367-7022

Las Vegas, NV 89113 • Odessa, FL 33556

EZ-Read Micrometer

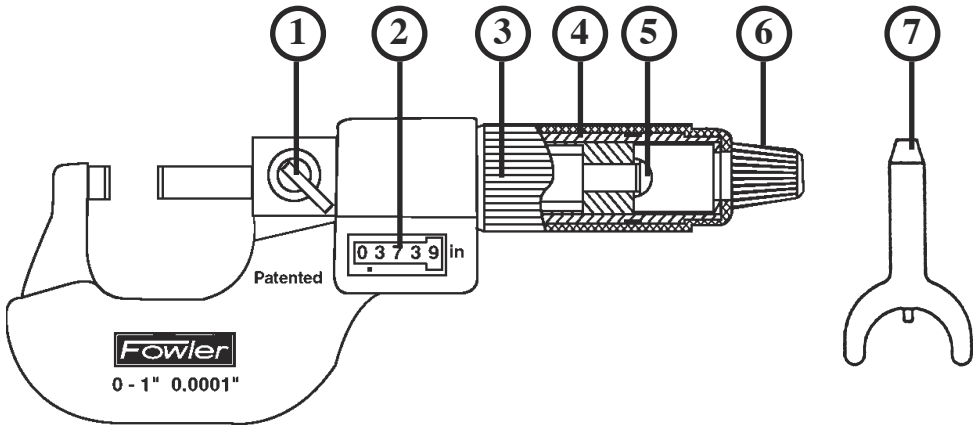

1. Functional Elements:

- (1) Locking device, (2) Digit counter, (3) Friction thimble,
- (4) Sleeve, (5) Screw, (6) End cap, (7) Spanner

2. Zero Setting (If digital alignment is askew.):

- 1.) Rotate friction thimble (3), set zero position for measuring face just as normal micrometers.
- 2.) Lock locking device (1), take off end cap (6).
- 3.) Hold frame (for non-rotating spindle type micrometers, hold sleeve (4)), loosen screw (5) with spanner (7) or a screw driver.
- 4.) Rotate sleeve (4) until the reading on the digit counter (2) is OK. The last rotating direction should be the same as measuring.
- 5.) Hold frame (for non-rotating spindle type micrometers, hold sleeve (4)), tighten screw.
- 6.) Unlock locking device (1). Set zero position for measuring face again. If the reading on digit counter (2) is not OK, repeat above process.
- 7.) Rotate friction thimble (3) backward to move the spindle back a little. Hold friction thimble (3), tighten screw (5) firmly.
- 8.) Replace endcap (6), make sure the end of the endcap (6) is in the keyway of the sleeve (4).

3. Precautions

- 1.) Tighten screw (5) firmly to insure accuracy.
- 2.) Do not disassemble and drop instrument.

! **CAUTION:** *Excessive speed may cause internal gear damage!*



PLASTIC PROCESS EQUIPMENT, INC.

8303 Corporate Park Drive, Macedonia, Ohio 44056

216-367-7000 • 800-362-0706 • Fax: 216-367-7022

Las Vegas, NV 89113 • Odessa, FL 33556